

AN 2000 C Load Monitor/ Signal Conditioner/Display

FEATURES

- 1 to 4 Transducer Power Supplies: 5 V or 10 V / 120 mADC
- 5 Red Digits (± 32000), 14 mm Height, 96 \times 48 mm Format
- 16 Acquisitions per Second
- Logic Inputs for Remote Functions
- Hold, Tare, Peak and Valley Functions
- Panel or DIN Rail Mounting
- IP 65 Front Panel (indoor use)
- 1 to 3 Flexible Configurations with Interchangeable Options:
 - 2 or 4 thresholds (relays)
 - 0–10 V / 4–20 mA analog output
 - RS-232C or RS-485 serial output
- Programmable with Front-Panel Keys
- Quick Wiring Using WAGO Connectors



DESCRIPTION

The AN 2000 C Load Monitor is designed to process and display signals coming from various types of transducers (weight, load, pressure, torque, etc.) that use standard strain-gauge bridges. It can also receive any signal within the range ±300 mV DC coming from a shunt, a converter or any type of transmitter.

The monitor provides selectable input ranges (15 mV, 30 mV, 60 mV or 300 mV) and excitation voltages (5 V or 10 V) to accommodate cells of various types and sensitivities. Two programming methods allow scaling the meter to operate in the desired engineering units.

The basic instrument consists of a PCB assembly including the main board, the display and the power supply filter, to which the A/D conversion circuit

to which the A/D conversion circuit and the input option are added. The latter two elements are connected by their own connectors.

The AN 2000 C is used with Magtrol Load Measuring Pins to measure load and force and provide overload protection. Magtrol also offers a wide range of Load-Force-Weight Transducers in various executions and accuracy classes and our Load Monitoring Units (LMUs) constitute an ideal safe measurement system which continuously checks for short-circuits and interrupted signal lines.

The functions of the basic instrument include the display of the input variable as well as the remote freezing of the display (HOLD), the reading of the stored minimum and maximum values (PEAK & VALLEY) and the TARE function with reset to zero.

OPTIONS

The following options can also be added to the AN 2000 C Load Monitor:

Control

ANA 4-20 mA / 0-10 VDC analog output

2RE 2 SPDT relay outputs, 8 A


4RE 4 SPST relay outputs, 0.2 A

Communication

RS2 RS-232C serial output RS4 RS-485 serial output

All outputs are opto-insulated with regard to the input signal.


SYSTEM CONFIGURATION-

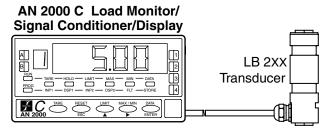



MEASUREMENT CHARACTERISTICS			
Transducer Power Supply	5 V or 10 V; 120 mA		
Signal Processing Type Conversion Speed Conversion Definition Response Delay (P filter) Cut-off Frequency Slope Input Damping (E filter)	Asymmetrical differential 16 conversions/second ± 16 bits 4 Hz to 0.05 Hz 14 to 37 dB/10 10 levels		
Input • Maximum Value • Resolution • Input Impedance	$\pm 300~\text{mV}$ 0.5 μA 100 M Ω		
Measurement Display	7-segment alphanumeric display ±32000 5 digits / 14 mm high (≈0.55 in.) / red 62 ms programmable		
Accuracy • Maximum Error • Temperature Coefficient • Warm-Up Time	± (0.1% of the reading + 2 count) 100 ppm/°C 5 min		
Overrange Indication	oUFLo		
OPERATING INDICATIONS (LEDs)			
RUN / PRG mode	2 green / orange LEDs		
Thresholds 1, 2, 3 and 4	4 red LEDs		
Indication Colors (6 LEDs)	orange yellow red orange yellow green		
Control Indication	TARE HOLD LIMIT MAX MIN DATA		
Programming Indication	INP 1 DSP 1 INP 2 DSP 2 FLT STORE		
Display of Program Steps	one 7-segment green LED		
KEYBOARD			
Operating Keys	TARE, RESET, LIMIT, MAX/MIN, DATA		
Programming Keys	TEACH, ESC, ▲ , ► ENTER		
PROGRAMMING			
5 Program Menus	1) Input configuration 2) Display configuration 3) Setpoint input 4) Analog output configuration 5) Serial RS-output configuration		
POWER SUPPLY			
AC	115 VAC; 50/60 Hz ±10% 230 VAC; 50/60 Hz ±10% 48 to 24 VAC; 50/60 Hz ±10%		
DC	10 to 30 VDC isolated		
ENVIRONMENTAL AND MECHANICAL CHA	RACTERISTICS		
Operating Temperature	-10°C to +60°C		
Storage Temperature	-25°C to +80°C		
Relative Humidity, Non-Condensing	<95% at 40°C		
Protection Class	IP 65 front panel; IP 45 housing		
Housing Material	UL 94V-0 polycarbonate		
Weight	600 g (1.32 lb)		


DIMENSIONS

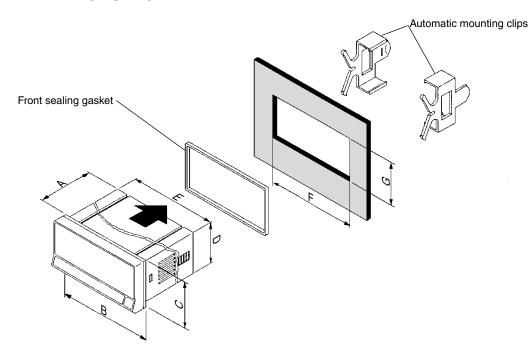

NOTE: Original dimensions are in Metric units. Dimensions converted to English units have been rounded up to 2 decimal places.

	mm	in
Α	120	4.72
В	96	3.78
С	48	1.89
D	42	1.65
Е	90	3.54
F	92	3.62
G	45	1.77

ASSEMBLY OVERVIEW

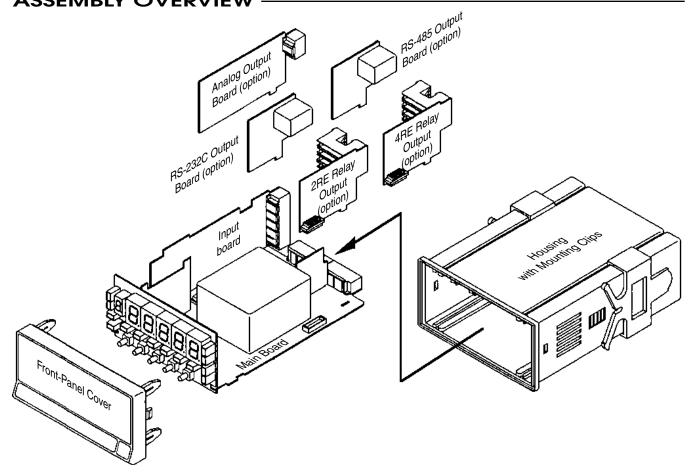



CONTROL OPTIONS -

Relay Output Boards (2RE and 4RE)

Characteristics	2 Threshold Values (2RE)	4 Threshold Values (4RE)
Number of Thresholds	2	4
Switching Capacity	8 A / 250 VAC	0.2 A / 250 VAC
Maximum Power	2000 VA / 192 W	25 VA / 10 W
Function	SPDT Single Pole Dual Toggle	SPST Single Pole Single Toggle (1 common for 4 relays)
Response Time	10 ms	6 ms
Programming	±32000	
Coupling	Independence and association 1-2 and 3-4	
Activation Mode	< or >	
Programmable Delay	0 to 999.9 s	
Programmable Asymmetrical Hysteresis	0 to 32000	
Programmable Symmetrical Hysteresis	0 to 32000	
Weight	≈40 g / ≈1.41 oz	

NOTE: The 2RE and 4RE output boards cannot be installed simultaneously in the monitor.

Analog Output Board (ANA)

This board is used to transmit displayed values (full or partial measuring range) by means of a 0–10 V or 4–20 mA isolated analog signal.

Characteristics	0-10 V Output	4-20 mA Output	
Resolution	12 bits / 0.1% FSD ±1 bit		
Response Time	60 ms		
Temperature Drift	0.2 mV/°C	0.5 μA/°C	
Maximum Load	≥ 500 Ω	≤ 800 Ω	
Weight	≈20 g / ≈0.71 oz		

COMMUNICATION OPTIONS -


Serial Output Boards (RS2 & RS4)

The RS2 and RS4 output boards allow serial communication with a personal computer or any other unit using a serial RS-232C or RS-485 transmission protocol, respectively. Both boards are also compatible with various graphic display and data acquisition software programs.

NOTE: The RS2 and RS4 output boards cannot be installed simultaneously in the monitor.

Characteristics	RS-232C Board (RS2)	RS-485 Board (RS4)
Baud Rate	1200, 2400, 4800, 9600, 19200	
Protocol	Standard, ISO 1745 or MODBUS	
Address	00 to 99	
Reading Functions of Displayed and Memorized Values	Valley, Peak, Tare, Measure, Thresholds 1 to 4	
Changing of Threshold Values	Thresholds 1 to 4 Digital indication of the threshold value	
Remote Controls (Reset)	Valley, Peak, Set Tare, Clear Tare	
Software Transfer	Only with ISO 1745 protocol	
Weight	≈45 g / ≈1.59 oz	

ORDERING INFORMATION

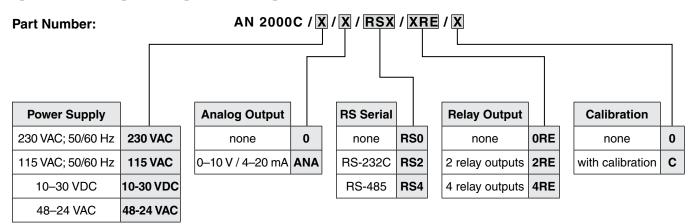

Example: An AN 2000 C with 230 VAC / 50/60 Hz power supply, analog output, RS-232C serial, 4 relay outputs and calibration would be ordered as part number AN 2000C / 230 VAC / ANA / RS2 / 4RE / C .

Due to the continual development of our products, we reserve the right to modify specifications without forewarning.



MAGTROL INC

70 Gardenville Parkway Buffalo, New York 14224 USA Phone: +1 716 668 5555 Fax: +1 716 668 8705

E-mail: magtrol@magtrol.com

MAGTROL SA

Centre technologique Montena 1728 Rossens/Fribourg, Switzerland Phone: +41 (0)26 407 3000 Fax: +41 (0)26 407 3001

E-mail: magtrol@magtrol.ch

Subsidiaries in:

- Germany
- France
- Great Britain
- China

Worldwide Network of Sales Agents



www.magtrol.com